


CIRCUIT IS DRAWN FOR A VALVE IN THE FULLY CLOSED POSITION

CIRCUIT IS DRAWN FOR A VALVE IN THE FULLY CLOSED POSITION

Circuit Diagram No - Issue No

5S02Q30A - 1

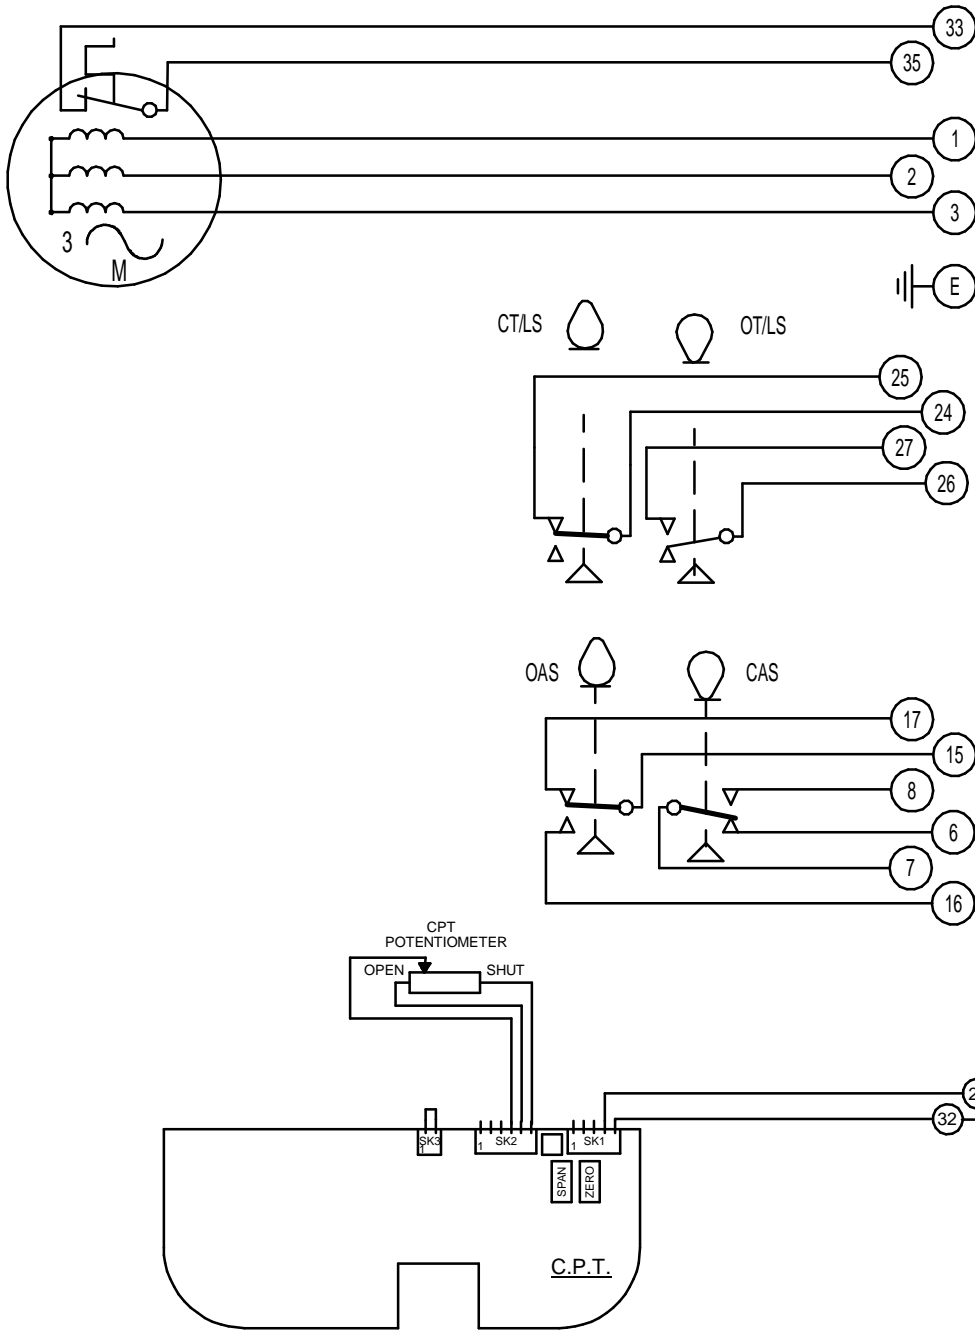

THERMOSTAT

3 PHASE SUPPLY

OT/LS - OPEN TORQUE/LIMIT SWITCH.
 CT/LS - CLOSE TORQUE/LIMIT SWITCH.
 OAS - OPEN AUXILIARY SWITCH.
 CAS - CLOSE AUXILIARY SWITCH.

WIRES ARE IDENTIFIED AT EACH END BY
 TERMINAL NUMBER OR NUMBER SHOWN.
 ALLOW MINIMUM 2 SECOND DELAY
 WHEN CONTROL SIGNALS ARE REVERSED
 TO ENSURE MOTOR REVERSAL.

WARNING

IT IS ESSENTIAL THAT REMOTE
 CONTROL CIRCUITS ARE DESIGNED
 SO THAT AN OPEN AND A CLOSE
 SIGNAL CAN NEVER BE APPLIED
 SIMULTANEOUSLY.

Iss	Date	Chkd	Revision Details
01	050218	JS	FIRST PRODUCTION ISSUE

centork
 ROTORK CONTROLS (INDIA) PRIVATE LTD
 28B, AMBATTUR INDUSTRIAL ESTATE (NORTH),
 AMBATTUR, CHENNAI - 600 098 INDIA.
 Tel:044-39555600

Q - 3 PHASE STANDARD + POT &
 EXTERNAL POWER CPT

Drawn by: JS
 Date : 150218
 Base WD: 5S00Q00
 Job No : ---
 MI No : .

Circuit Diagram No	Issue No
5S02Q30A	1